

Manhole Inspection Summary

Manhole # S21SS1019MH

Printed On: 12/17/2008

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **21SS1** Node: **019** Status: **Found**

Insp Date: **12/6/06 1:45 PM**

Incomplete Comments

Crew: **WM, BC**
Inspector: **Morris, W**
Firm: **RKK**

Location Address: **HAMILL RD**

Cross Street: **HAMILL RD**

Manhole Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **The I9 pipe invert is deeper due to the ground elevation.**

Cover Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **1** (in.) Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

Chimney / Frame Adjustment ☒ Exists Material: **Brick** ☐ Parged Height: **3** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Barrel Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **42** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged ☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged ☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Deteriorated** ☐ Leaks ☐ Debris

Steps Count: **0** Missing: **0** ☐ Corroded

Surcharge ☒ **Evidence Of Surcharge** Depth: **1** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S21SS1019MH

Printed On: 12/17/2008

Page 2 of 3

Location View



Top View



Evidence of surcharge - Bench debris.

Defect



Frame leaks. Frame offset. Adjustment and Corbel infiltration.


Manhole Inspection Summary

Manhole # S21SS1019MH

Printed On: 12/17/2008

Page 3 of 3

6 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock

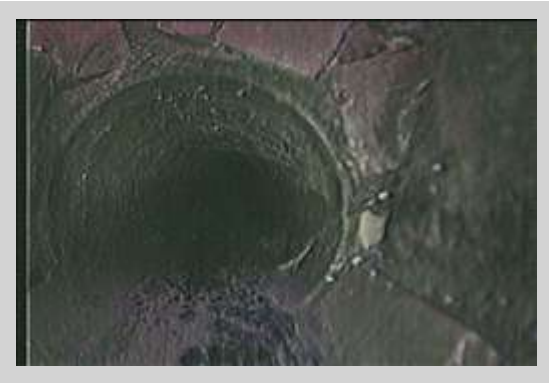

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **3.26** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

6 in. Circular Gravity Sewer Pipe In @ 9 O'Clock



Barrel deterioration and infiltration. Channel deterioration.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **3.22** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ Debris ☒ Grease

Silt Depth: **0** (in.) Deposits Extent: **Light**

Infiltration: **Evidence** Pipe Seal Cond: **Broken**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection